

Manhole Inspection Summary

Manhole # S21CC2001MH

Printed On: 12/17/2008

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **21CC2** Node: **001** Status: **Found**

Insp Date: **11/20/06 1:25 PM**

Incomplete Comments

Crew: **JJ, JY**
Inspector: **Jensen, J**
Firm: **RKK**

Location Address: **5523 MATTFELDT AVE**

Cross Street: **FALLS RD**

Manhole Type: **Inline**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **18** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☒ **Debris**

Steps

Count: **8** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View



Corroded steps. Bench debris.

Defect



Barrel infiltration.

Defect



Adjustment deterioration and infiltration.
Barrel infiltration.

Defect



Barrel deterioration and infiltration. Bench
and Channel deterioration.

Defect



Barrel deterioration and infiltration. Bench
and Channel deterioration.

Defect



Adjustment deterioration and infiltration.


Manhole Inspection Summary

Manhole # S21CC2001MH

Printed On: 12/17/2008

Page 4 of 5

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

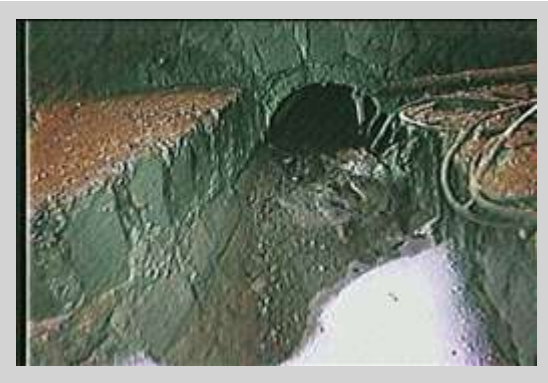

Pipe debris.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.10** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Medium**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 5 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.23** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop In @ 5 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **10.40** (ft.)

Inv Depth: **11.40** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S21CC2001MH

Printed On: 12/17/2008

Page 5 of 5

6 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Barrel deterioration and infiltration. Bench and Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.64** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Weeper** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection